Clay County, Missouri
Land Survey Document

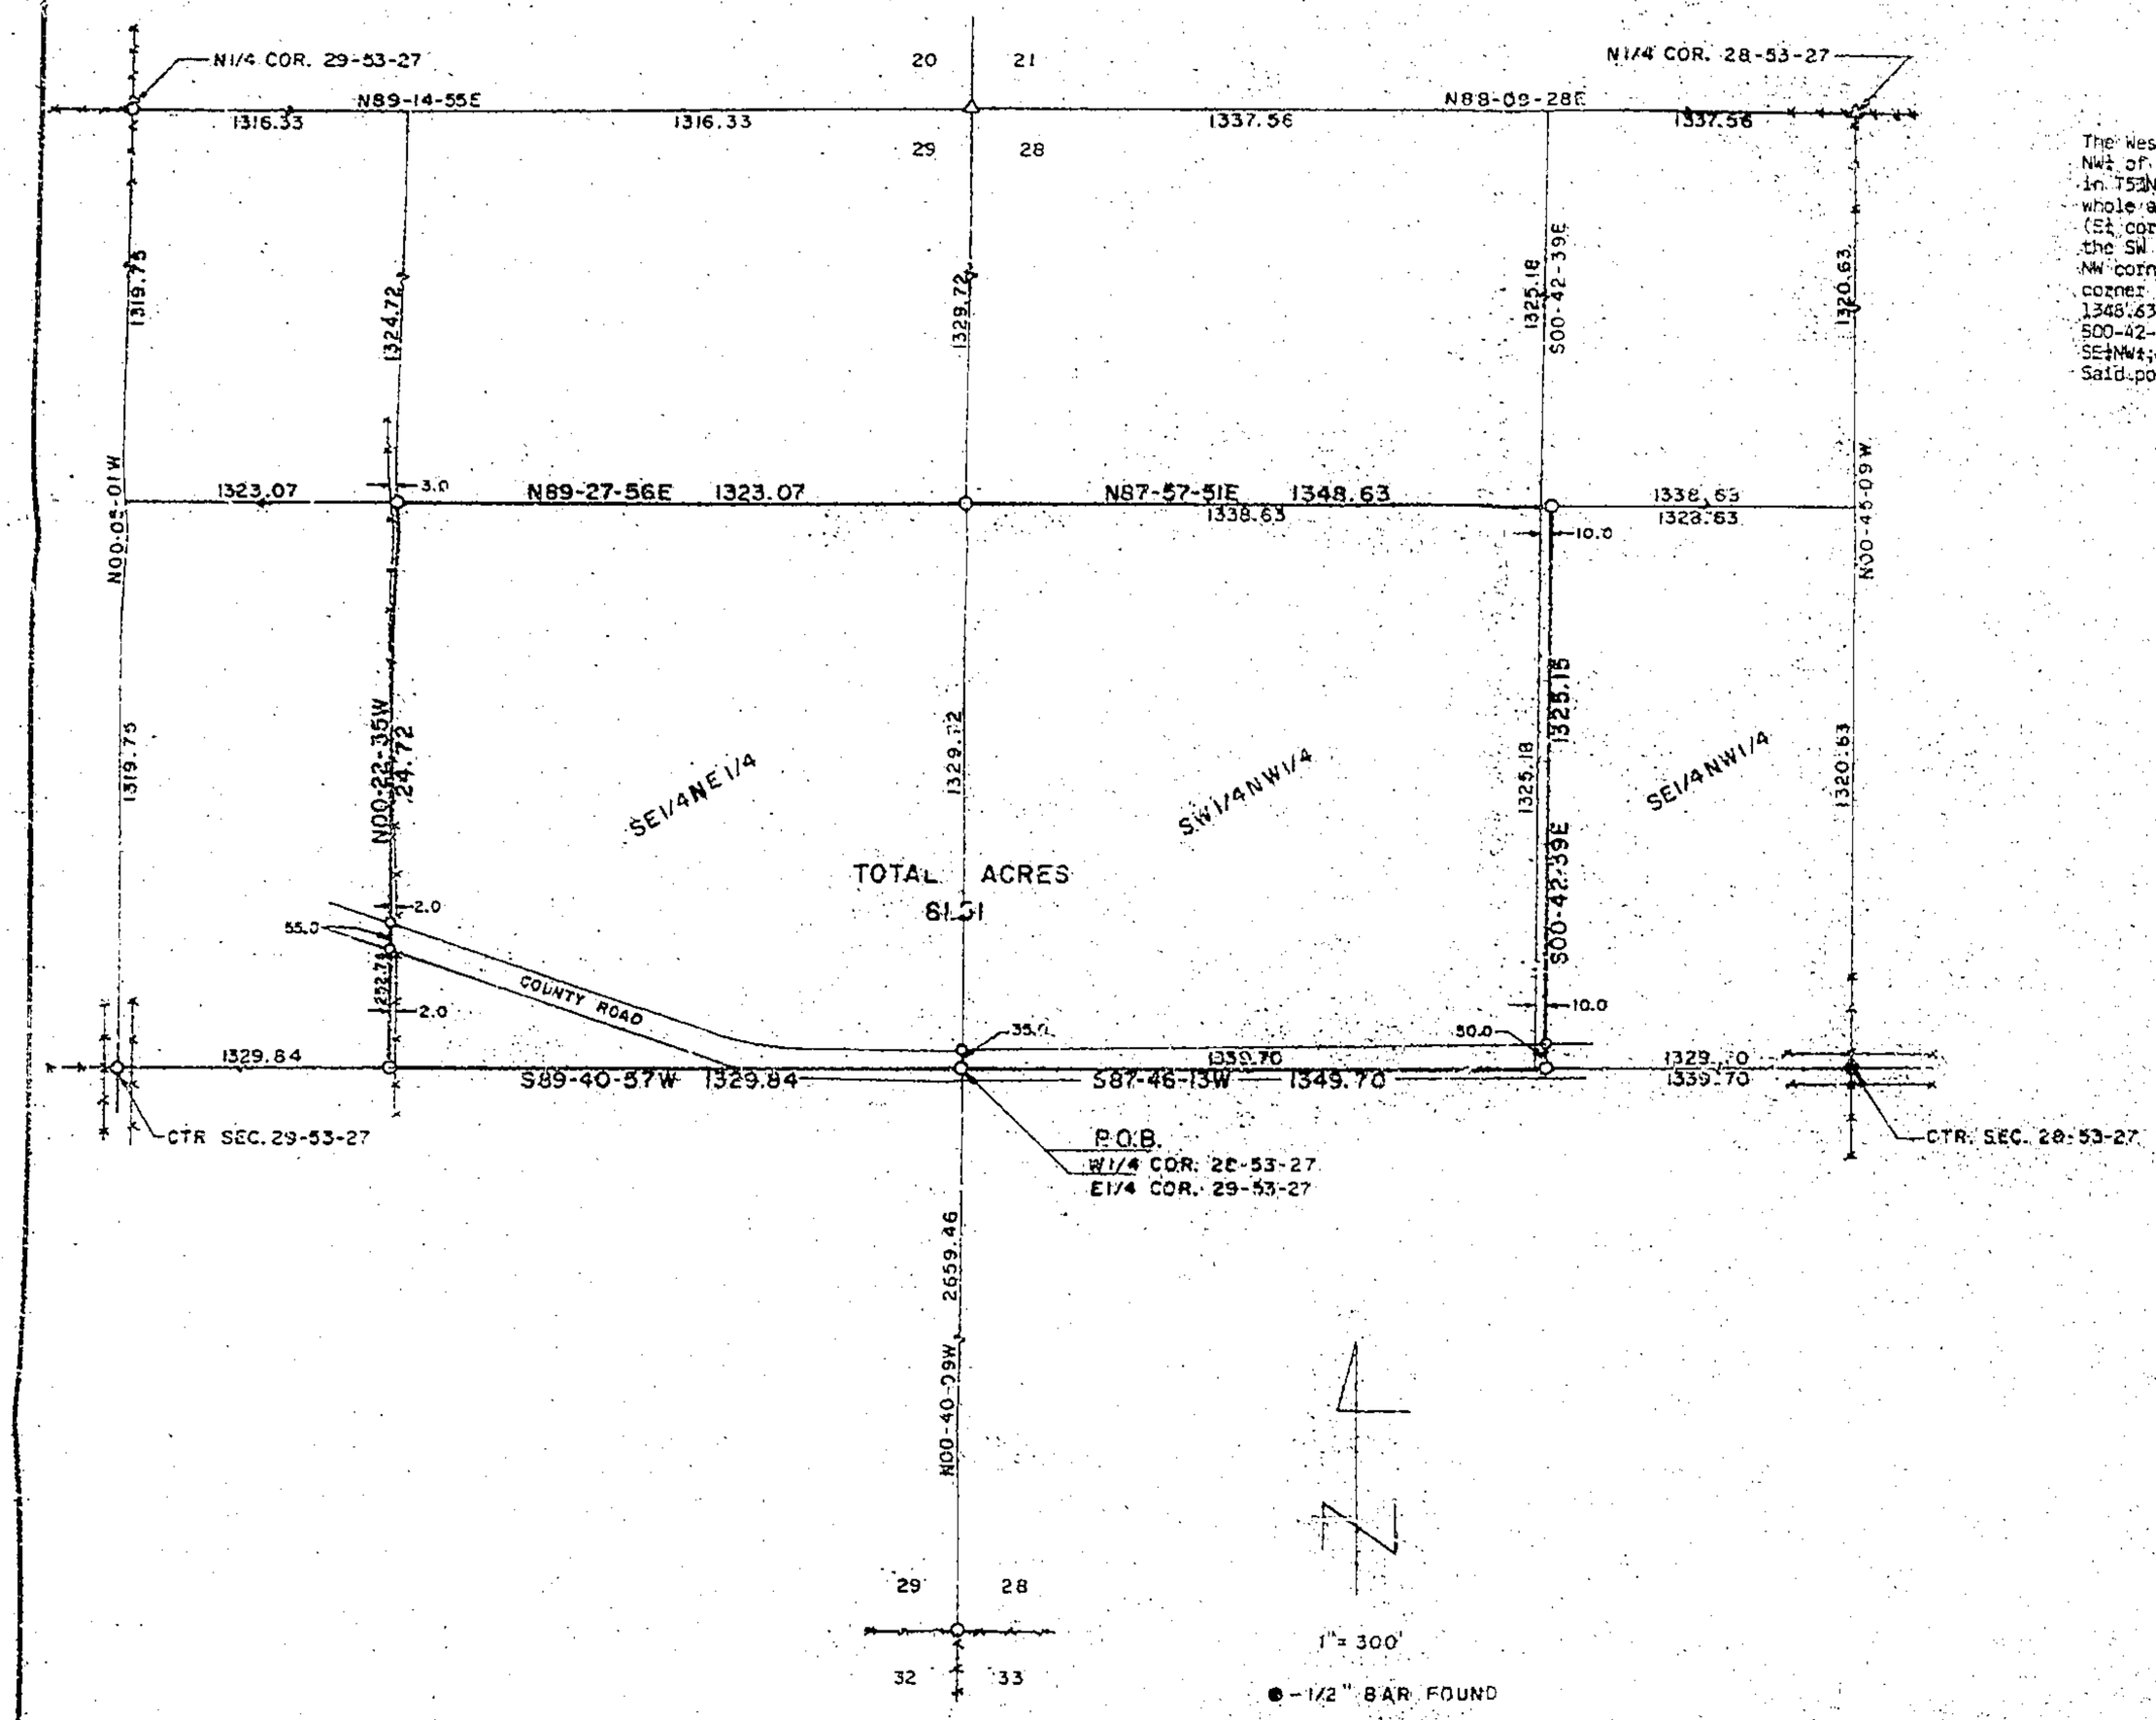

1" = 300'

● - 1/2" BAR FOUND

O - 1/2" BAR SET

Δ - COR. WHICH EXISTED 9-23-1980
VICTIM OF BULLDOZER

DESCRIPTION

The West 10.0 feet of the SE¼ of the NW¼ and all of the SW¼ of the NW¼ of Section 28 and all of the SE¼ of the NE¼ of Section 29, all in T53N, R27W of the 5th P.M., Ray County, Missouri described as a whole as follows: Beginning at the W¼ corner of said Section 28 (E¼ corner of said Section 29); thence S89-40-57W, 1329.84 feet to the SW corner of said SE¼NE¼; thence N00-22-35W, 1324.72 feet to the NW corner of said SE¼NE¼; thence N89-27-56E, 1323.07 feet to the NE corner of said SE¼NE¼ (NW corner of said SW¼NW¼); thence N87-57-51E, 1348.63 feet to the NE corner of said West 10.0 feet SE¼NW¼; thence S00-42-39E, 1325.15 feet to the SE corner of said West 10.0 feet SE¼NW¼; thence S87-46-13W, 1349.70 feet to the point of beginning. Said portions contain 81.51 acres.

STATE OF MISSOURI
DAVID J. MONROE
NUMBER LS-1433
REGISTERED LAND SURVEYOR

5/1/86 pm
750-Sami

SURVEYOR'S CERTIFICATION

I hereby certify that this plan, plat, map, survey or report was prepared by me or under my direct personal supervision and that I am a duly registered Land Surveyor under the laws of the State of MISSOURI.

Date: 3-13-1986 Signed: David J. Monroe
David J. Monroe MO. REG. NO. 1433

M & M LAND SURVEYING SERVICE, INC.
RAY COUNTY COURTHOUSE
P.O. BOX 63, RICHMOND, MO 64085
OFFICE 816/776-5343 HOME 816/392-4578

SURVEY FOR: AMERICAN BANK
RICHMOND, MO.

3-13-1986	86-36	1" = 300'	DM	86-704

750-23291

Filed with Missouri Department of Natural Resources
April 29, 1986

LANE ENGRAVING CO. 221-2530

http://www.ClayCoGov.com